

Problemi in fognatura



Fessurazione, spaccatura, longitudinale, (12), Lar. =0mm

00 00 52 S15 da CAM.9431b a CAM.9441

25.07.14 09:25 PG: 48

LZ1: +0001.80 m



00 01 44

S15 da CAM.9431b a CAM.9441

25.07.14 09:26 PC: 48

LZ1: +0003.50 m

04.10.13

10:49

TU 00:00:00

L

4.8m

CR

2:30→

CO

40





27-03-12  
09:46:09

517/518 VIA VIGANO BESANA BRIANZA  
0:11:41 0 -17 -1.7% 11.51m

27-03-12  
09:47:00

517/518 VIA VIGANO BESANA BRIANZA  
0:12:17 0 -21 0.2% 15.95m



Radici, tappo di radici, (01 - 12), Tras.-Rid. =70%

08 14 36

S04 da CAM.8861 A CAM.6871

10.07.14 12:22 PC: 12

LZ1: +0010.60 m

04.10.13 10:56 TU 00:00:00

UYA KIRGIZOMI COMBU  
253 5 3 334  
340C 0306000000 6100

L 35.5m CR 6:00↓ CO -21 ↑



04.10.13 10:56 TV 00:00:00

UIC MERCURY CONDUITE

250 (3.3 ft)

PUCC (0.0001) 100% 4000

L 35.9M CR 6:00↓ CO -9 ↑





Fotografia: 1\_3A

95,51m, Allacciamento difettoso: intasato, a ore 10

TI



04.10.13 FOTO TV 00:00:00  
VIA MARCONI CARNATE  
1251 -> 251  
PUC circolare 400

L 42.4m CR 2:45→ CO -1 ↑

### Foto sezione - 03/05/2018 - da 461 a 463 VS V

Comune / Città	Strada	Data	Nome sezione	Nr.
Ornago	Via Banfi	03/05/2018	da 461 a 463 vs v	1



13, 00:15:40, 50.44  
Nota generale



14, 00:15:51, 51.62  
Nota generale

Comune / Città: Ornago  
Strada: Via Banfi  
Pozzetto a monte: 461

🖱️ 🖐️ ⌚ ⏪ ⏩ 139% 📄 🗒️ 📎 📷 📶

Strada: Via Banfi  
Pozzetto a monte: 461

06.09.12

09:16

TU 00:00:00

L 0.0m CR 3:00→ CO -0 ↑



06.09.12

09:19

TU 00:00:00

L 0.0m CR 2:15→ CO 113

07.09.12

16:26

TU 00:00:00

VIA CIUCANI ORNAGO

13N -> 6N

GRES circolare 200

L

6.4m

CR

5:15↓

CO -135 ✓

06.09.12

10:29

TU 00:00:00

VIA CIUCANI ORNAGO

1B -> 8B

PVC circolare 300

L

2.6m

CR 12:00↑

IL

-4.8%

06.09.12

10:29

TU 00:00:00

VIA CILICANI ORRACU

1B -> 8B

PVC circolare 3133

L

2.8m

CR 11:15

IL

-0.7%

06.09.12

10:30

TV 00:00:00

VIA CIUCANI ORNAGO

1B -> 8B

PUC circolare 300

L

20.3m

CR 10:45

IL

-21.2%

06.09.12

10:32

TU 00:00:00

VIA CIUCANI ORNAGO

1B -> 8B

PVC circolare 300

L

51.5m

CR 12:15↑

IL

-13.0%

06.09.12

14:42

TU 00:00:00

VIA CIUCANI ORNAGO

5B ← 4B

calcestruzzo CLS circolare 1200

L


11.7m

CR

9:00←

CO


-30 ↖

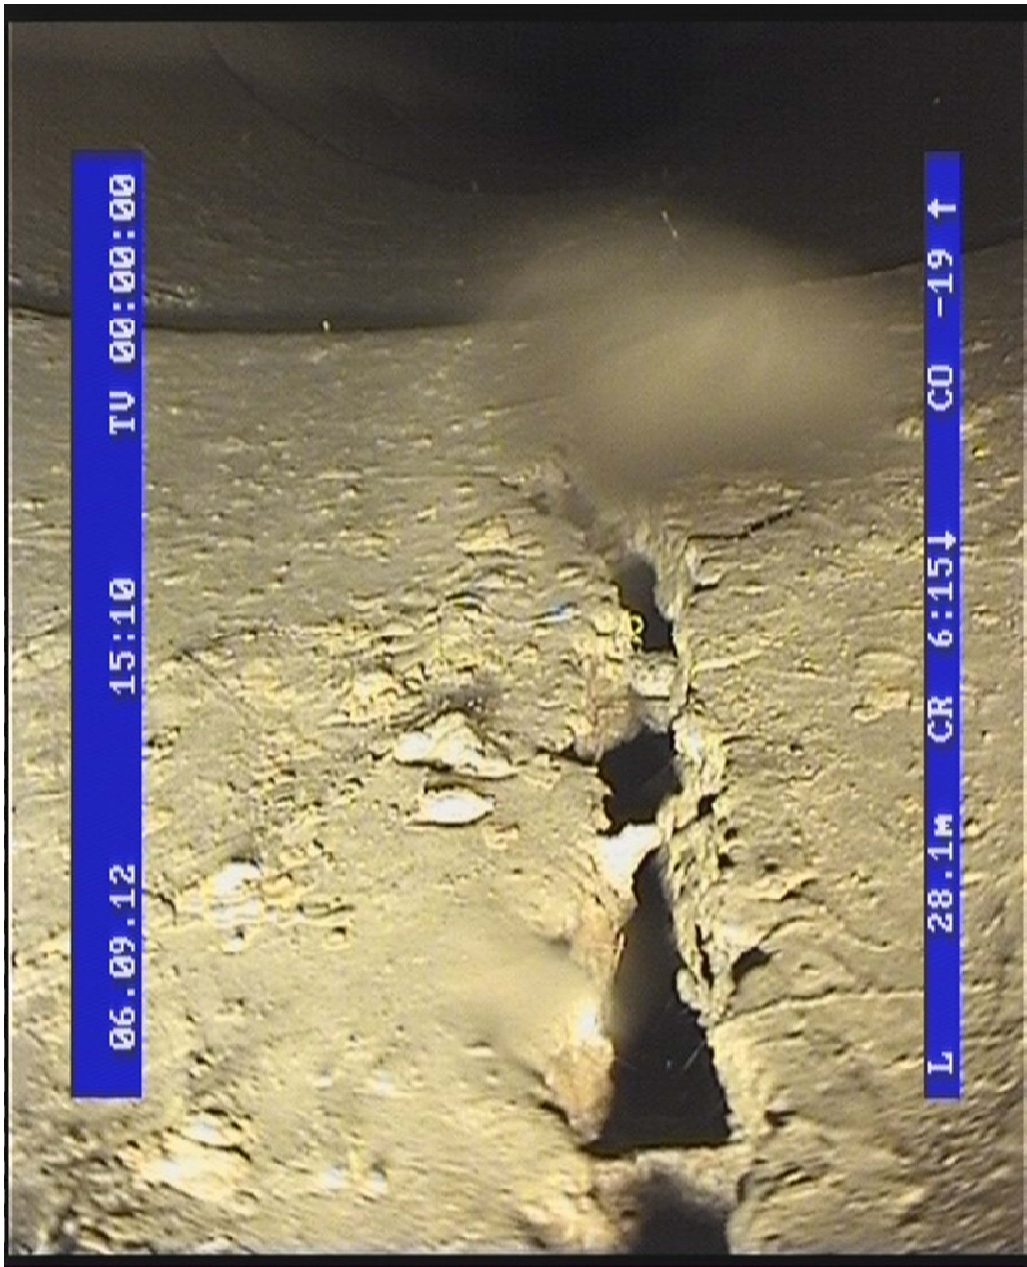

06.09.12 15:10 TV 00:00:00

L 28.1M CR 6:15↓ CO -19 ↑



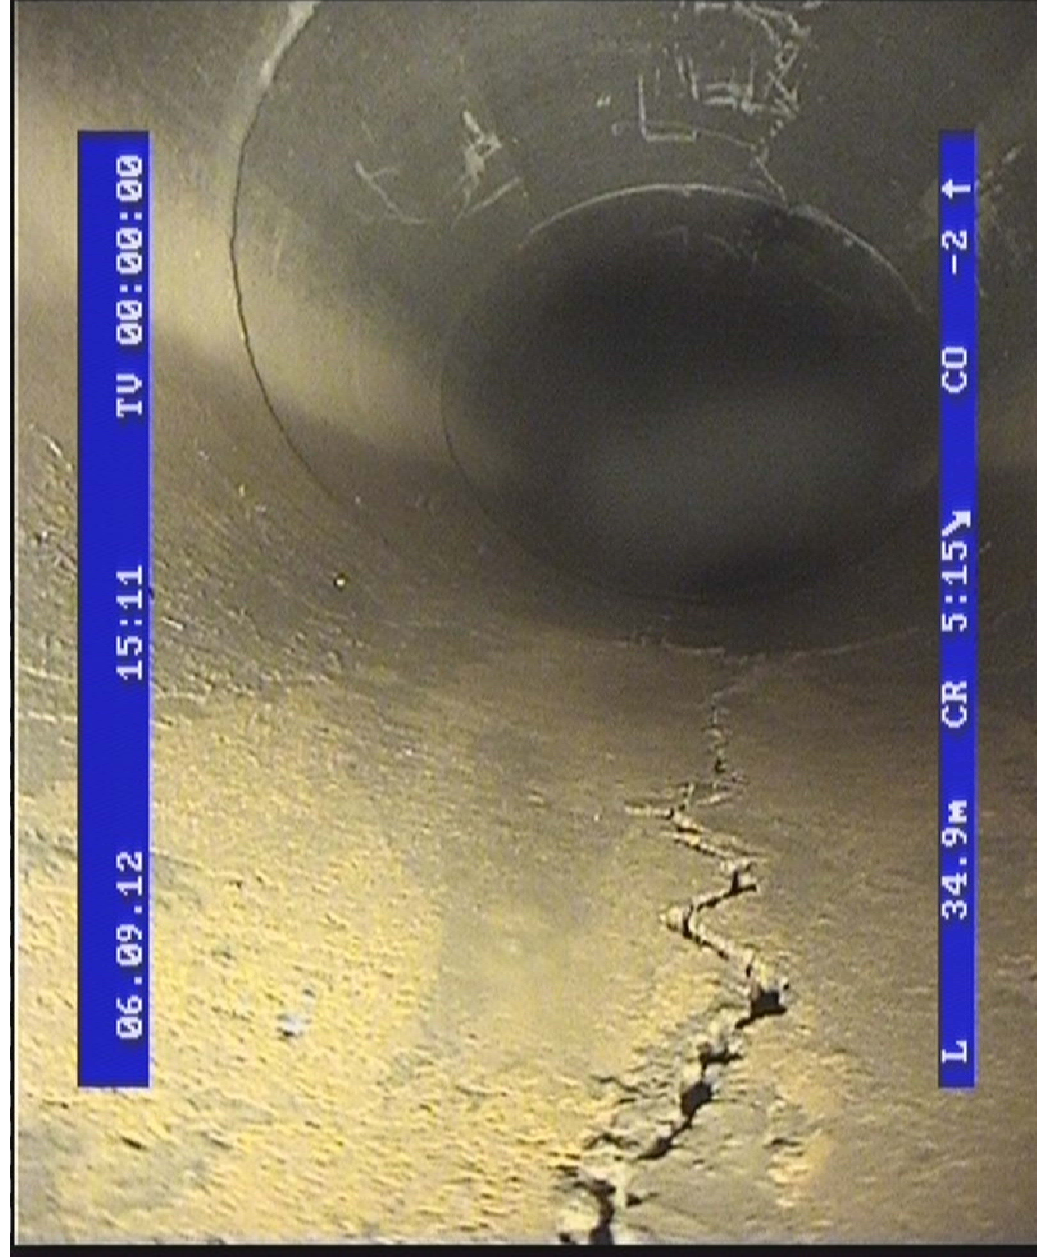

06.09.12 15:11 TV 00:00:00

L 34.9m CR 5:15 CO -2 ↑

